
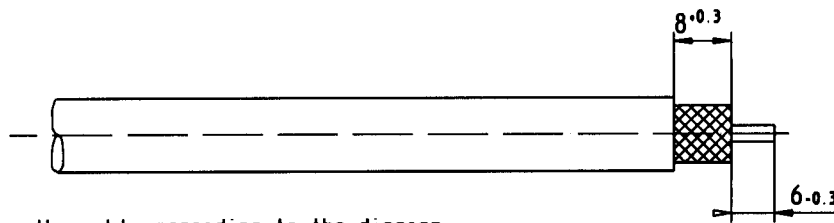


Assembly instruction: 53 B


Series: N

Straight connector
for flexible cable

Cable entry:
Center contact - soldered
Braid - clamped

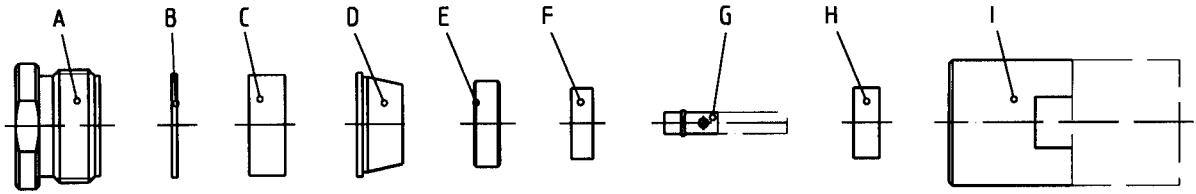


1) Prepare the cable according to the diagram.

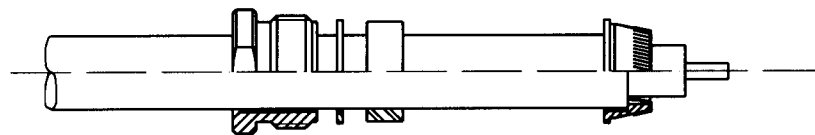


2) Slide nut 'A', washer 'B' and gasket 'C' onto the cable.

3) Push clamp 'D' over the braid and fold the braid back over the clamp.

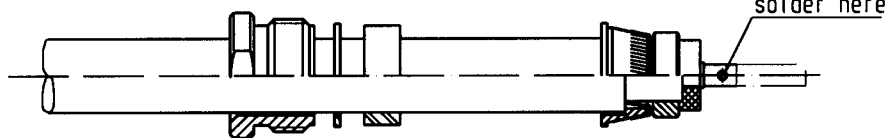

4) Slide clamping sleeve 'E' and insulator 'F' onto the cable dielectric.

5) Push center pin 'G' over the inner conductor of the cable up to the dielectric and solder it.

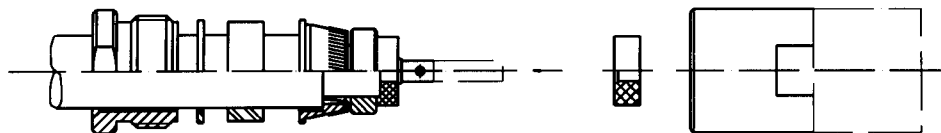

6) Slide insulator 'H' onto the center pin.

7) Insert the prepared cable into the connector body 'I' and tighten down nut 'A'.

Für diese technische Unterlage behalten wir uns alle Rechte vor (DIN 34)

				Rosenberger			Tools:	
				Hochfrequenztechnik 84526 Tittmoning			Stripping tool	
				CAD			Soldering equipment	
							Two 16mm Spanners	
				Bearb.	10.05.1996	Krautnb.Sa.	M 1:1	
a	CAD-MTP	10.05.96	Kra.Sa.	Gepr.			Blatt 1	
Zust	Aenderung	Datum	Name					