
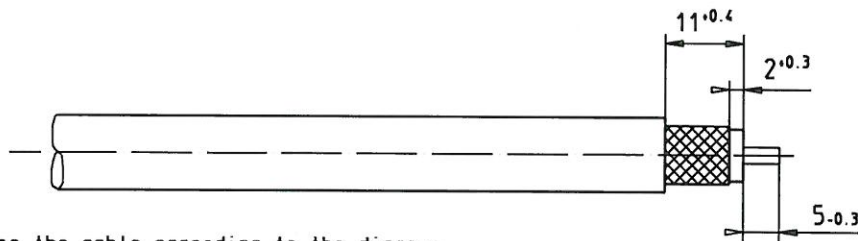


# Assembly instruction: 53 03


Series: N

Straight connector  
for flexible cable


Cable entry:  
Center contact - crimp  
Braid - crimp

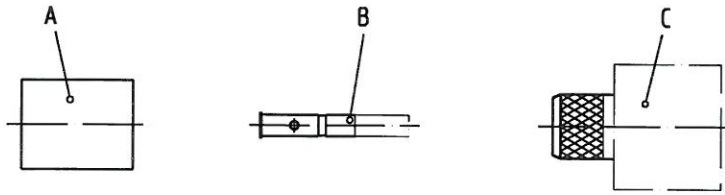

1) Prepare the cable according to the diagram.

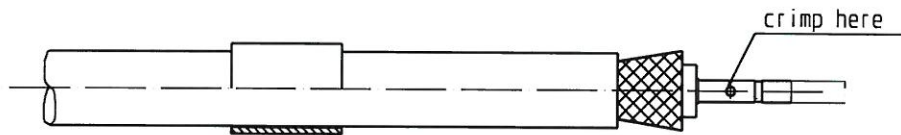

- 2) Slide ferrule "A" onto the cable.
- 3) Push center pin "B" over the inner conductor of the cable up to the dielectric and crimp it. \*)
- 4) Splay out the braid.

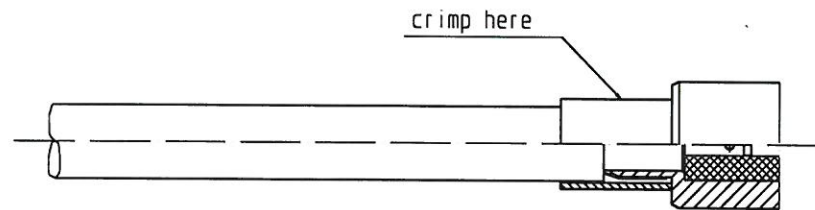

- 5) Insert the prepared cable into the connector body "C" until the center pin engages perceptibly. Ensure that the braid covers the knurled connector end.
- 6) Slide ferrule "A" over the braid up to the connector body and crimp as close to the connector body as possible. \*)

\*) For the crimping die part-nr. please consult the relevant customer drawing.

Iuer diese technische Unterlage behalten wir uns alle Rechte vor (DIN 34)

**Rosenberger**  
Hochfrequenztechnik  
84526 Tittmoning

Tools:

Stripping tool  
Crimp tool 11 W 150-000

Bearb. 28.05.1996 Kra.Sa. M 1:1  
Gepr. Blatt 1

Zust	Aenderung	Datum	Name
o	CAD-MTP	28.05.96	Kra.Sa.