
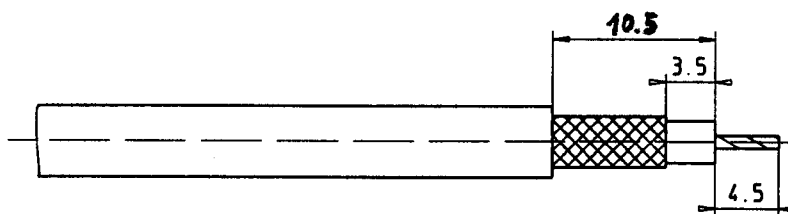



Assembly instruction: 51 P15 Series: BNC ; TNC

Straight connector
for flexible cable


Cable entry:
Center contact - crimp
Braid - crimp

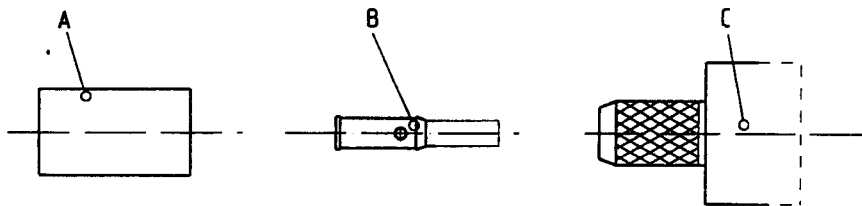

1) Prepare the cable according to the diagram.

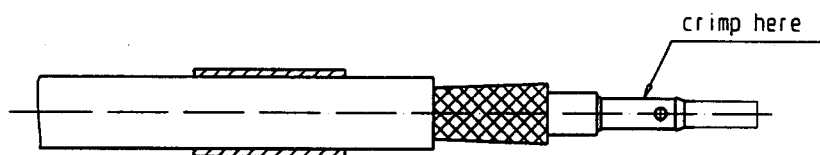

- 2) Slide ferrule "A" onto the cable.
- 3) Push center pin "B" over the inner conductor of the cable up to the dielectric and crimp it. *)
- 4) Splay out the braid.

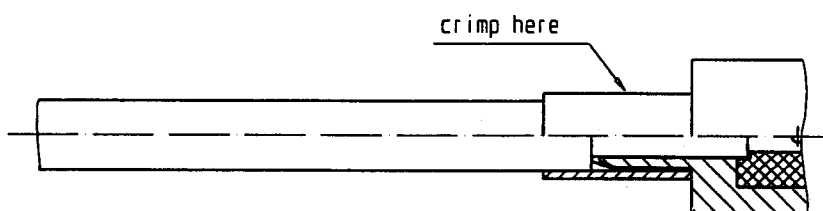

- 5) Insert the prepared cable into the connector body "C" until the center pin engages perceptibly. Ensure that the braid covers the knurled connector end.
- 6) Slide ferrule "A" over the braid up to the connector body and crimp as close to the connector body as possible. *)

*) For the crimping die part-nr. please consult the relevant customer drawing.

Iuer diese technische Unterlage behalten wir uns alle Rechte vor. (DIN 34)

			Rosenberger Hochfrequenztechnik 84526 Tiltmoning		CAD		Tools:	
			Bearb. 12/02/07 <i>Selmer</i>		M 2:1		Stripping tool	
			Gepr.		Blatt 1/1		Crimp tool 11 W 150-000	
							or 11 W 100-000	
01	concept	12/02/07	RF					
Zust.	Aenderung	Datum	Name					